

- 1- When preparing the vehicle for delivery to the customer, the technician has detected that the clean water tank is leaking.
The tank leaks through the sheath of the electric cables of the water pump and through the level probe.
The technician has sealed the sheath with silicone and has tightened the cap. He has also removed the water probe, has filed down the area of the tank where it sits and has reassembled it with a silicone gasket.

- 2- The technician has also detected that the rubber on the kitchen sink hinges were in poor condition, out of shape and wrinkled, the technician has changed them, for this he had to remove the complete hinges.